



# Inspection Report

Inspection Date: 2024/04/11

## Excavators

### General Information

<b>Maker</b>	CAT		
<b>Model Number</b>	308E2SR-E		
<b>Year</b>	2016		
<b>Hour (h)</b>	2383	<b>Meter</b>	Working
<b>Serial Number</b>	CAT0308ECKC500171		

### Options

- CAB	- Speed changer
- Multilever	- Air conditioner
- Blade	
- Arm Crane	
- EPA	

### Upper Structure

		Cylinder		Play
		Oil Leak	Scratch/Rust	
Boom	Left	No	No	No
	Right	No	No	
Arm		No	No	No
Bucket		No	No	Small
Bucket Size (mm)	700			

### Note for External Appearance




### Undercarriage

<b>Shoe Type</b>	Steel shoes with rubber pads		
<b>Swing Circle</b>	No oil leak		
	<b>Left</b>	<b>Right</b>	
Shoe Width (mm)	450	450	
Idler	OK	OK	
Sprocket	OK	OK	
Pin Bush	OK	OK	
Upper Roller	OK	OK	
Track Roller	OK	OK	
Shoe Link	OK	OK	

### Note for Upper Structure

- No bucket side cutters
- The edge of the blade is turned up

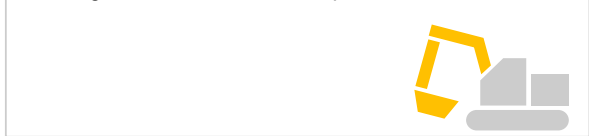

### Note for Undercarriage



### Engine

<b>Model</b>	C3 3B
<b>Serial Number</b>	
<b>Engine Oil Leak</b>	No oil leak
<b>Engine Oil Gauge</b>	OK
<b>Radiator</b>	OK
<b>Exhaust Color</b>	Normal
<b>Blow-by</b>	No
<b>Engine Sound</b>	OK
<b>Hydraulic Pump</b>	No oil leak
<b>Water Pump</b>	No water leak
<b>Oil Cooler</b>	No oil leak
<b>Motor</b>	No oil leak
<b>Multi Lever</b>	No oil leak

### Note for Operating Component



### Note for Engine



Admin No. 3000057651